

THE FOLLOWING PAGE CONTAINS THE CONNECTION DETAILS

It is your responsibility to ensure that the transducer identification matches the connection details, including any RDP modification (T.M) references.

Please ensure that the transducer has not been modified or fitted with a cable or extension.



Particularly on DC-DC powered transducers, incorrect connection may cause **IRREPERABLE DAMAGE** to the transducer which is **NOT COVERED BY WARRANTY**

**IF YOU ARE IN ANY DOUBT PLEASE CONTACT US**



# DCWC SERIES

(CABLE OPTIONS 2, 3, 4, 5, 8, 10 & 11)

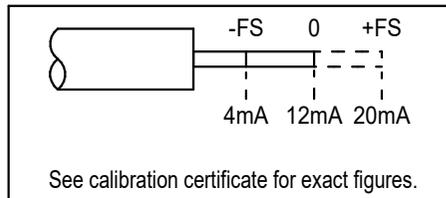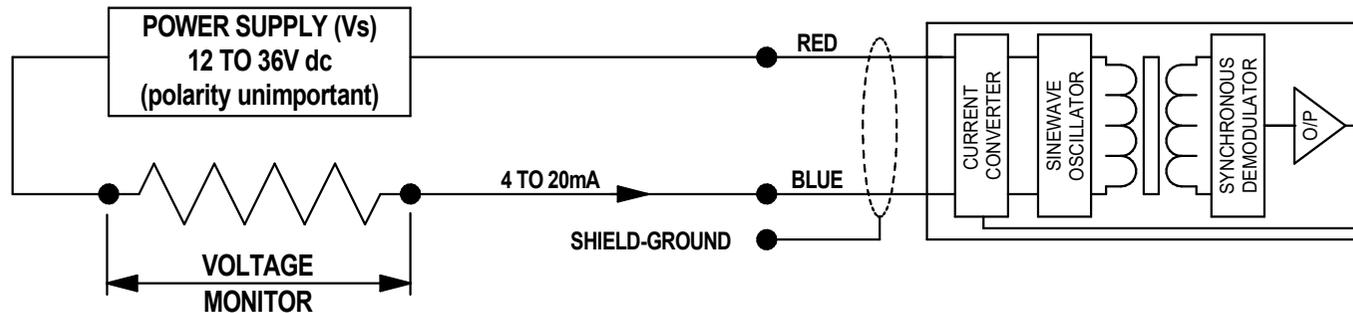

- MAX LOOP RESISTANCE**  $(V_s - 11) \times 50 \text{ Ohms}$   
(Including monitor and cable resistance)
- BANDWIDTH** 250Hz (flat)
- NOISE** 50uA peak to peak max
- SPAN TEMPCO** 0.03% F.S./°C (Typical)
- OPERATING TEMP** -10°C to +70°C
- CALIBRATION** 24V dc (see calibration certificate)
- SUPPLY** Smooth d.c. voltage 12 to 36V

**NOTE : INCORRECT CONNECTION MAY CAUSE IRREPARABLE DAMAGE  
CONTACT OUR SALES DEPARTMENT IF YOU REQUIRE ASSISTANCE**

**RDP U.K.**  
Tel 01902 457512  
Fax 01902 452000



**MADE IN THE  
UNITED KINGDOM**

Doc. Ref. WDUK1902  
ISSUE 1 - 16 OCT 2019

**RDP U.S.A.**  
Tel 610 469 0850  
Fax 610 469 0852